

Work Order ID 98975

98975

Page 1

March-28-13 10:47:49 AM

Item ID: D3391-023

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Item Name: Mid Tube Assembly

Stop ***NS2***

Start Date: 3/27/13 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 3/27/13 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: MLJ Date: 13-04-01 Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

| Sequence ID/ Work Center ID | Operation Description | Set Up/ Run Hours | Tool ID | Tool # | Plan Code | Accept Qty | Reject Qty | Reject Number | Insp. Stamp |
|--------------------------------|--------------------------|----------------------|---------|--------|--------------|---------------|---------------|------------------|----------------|
|--------------------------------|--------------------------|----------------------|---------|--------|--------------|---------------|---------------|------------------|----------------|

| Draw Nbr | Revision Nbr |
|----------|--------------|
| D3391 | I |

100

0.00

100

Skidtubes

Skidtubes

0.00

Skidtubes

Memo

1-Cut tube to finish length as per Dwg D3391

2-Drill pilot holes using DT8796 (Do not drill "B" holes) and drill only 1 fwd saddle hole on one side only as per Dwg D3391

3-Open saddles and GHW holes to Ø0.375" except for fwd saddle hole of detail "J"

4-Remove .030" from Fwd indexing Ridge as per Dwg D3391

5-Remove indexing ridge on Fwd & Aft end of skidtube as per Dwg D3391

6-Deburr

7-Drill #30 pilot holes using wearplate Jig DT8217 Identify Ø0.250" holes with paint marker,

***DO NOT DRILL HOLES #3-19-20 FROM FWD END OF JIG

8-Open wearplate holes of D3391-023 assembly detail section G-G to Ø0.250" (10 holes) as per Dwg D3391

9-Open wearplate holes of D3391-023 assembly detail section H-H to Ø0.297" (20 holes) as per Dwg D3391

DO NOT OPEN 2 MOST FWD WEARPLATE HOLES

- DC 13/05/08

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

| | | |
|--|---|---|
| Work Order: _____ Part No. _____ NCR No. _____ | DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/> | AGAINST DEPARTMENT/PROCESS <div style="display: flex; justify-content: space-between;"> <div> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/> </div> <div> Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/> </div> <div> Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/> </div> <div> Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/> </div> </div> |
|--|---|---|

| Root Cause | Date | Step | Qty | Description of work order update or Non-conformance | Initial Chief Eng | Action Description | Sign & Date | Verification | QC Inspector |
|---------------|------|------|-----|---|-------------------|--------------------|-------------|--------------|--------------|
| Doc/Data | | | | | | | | | |
| Equip/Tooling | | | | | | | | | |
| Operator | | | | | | | | | |
| Material | | | | | | | | | |
| Setup | | | | | | | | | |
| Other | | | | | | | | | |
| Process | | | | | | | | | |
| Supplier | | | | | | | | | |
| Training | | | | | | | | | |
| Unapproved | | | | | | | | | |

FAULT CATEGORY

| Landing Gear | General | Other |
|---|---|--|
| <input type="checkbox"/> Bending | <input type="checkbox"/> Bend | <input type="checkbox"/> Grain |
| <input type="checkbox"/> Centre Not Concentric to O/S | <input type="checkbox"/> BOM/Route | <input type="checkbox"/> Hardware |
| <input type="checkbox"/> Cracks | <input type="checkbox"/> Broken/Damaged | <input type="checkbox"/> Inspection Incomplete |
| <input type="checkbox"/> Crushed/Crimped | <input type="checkbox"/> Burrs | <input type="checkbox"/> Instructions Incomplete/Unclear |
| <input type="checkbox"/> Cuffs | <input type="checkbox"/> Contamination | <input type="checkbox"/> Maintenance |
| <input type="checkbox"/> Heat Treat | <input type="checkbox"/> Countersink | <input type="checkbox"/> Mislabelled |
| <input type="checkbox"/> Inspection Strip in Tube | <input type="checkbox"/> Cut Too Short | <input type="checkbox"/> Misread |
| <input type="checkbox"/> Ripples in Bend | <input type="checkbox"/> Drill Holes | <input type="checkbox"/> Offset |
| <input type="checkbox"/> Torque Waves in Extrusion | <input type="checkbox"/> Drawing | <input type="checkbox"/> Out of Calibration |
| <input type="checkbox"/> Turning Sequence | <input type="checkbox"/> Finish | <input type="checkbox"/> Out of Sequence |
| <input type="checkbox"/> Wave/Twist in Tube | <input type="checkbox"/> Folio | <input type="checkbox"/> Outside Dimensions |
| | | <input type="checkbox"/> Ovalized |
| | | <input type="checkbox"/> Over/Under tolerance |
| | | <input type="checkbox"/> Part Incorrect |
| | | <input type="checkbox"/> Part Lost/Missing |
| | | <input type="checkbox"/> Part Moved |
| | | <input type="checkbox"/> Positioned Wrong |
| | | <input type="checkbox"/> Power Loss/Surge |
| | | <input type="checkbox"/> Pressure/Forced |
| | | <input type="checkbox"/> Temperature/Cure |
| | | <input type="checkbox"/> Weld |
| | | <input type="checkbox"/> Wrong Stock Pulled |
| | | <input type="checkbox"/> Other |

Work Order ID 98975***98975***

Page 2

March-28-13 10:47:49 AM

Item ID: D3391-023

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Mid Tube Assembly

Start Date: 3/27/13

Start Qty: 1.00

1

Cust Item ID:

Required Date: 3/27/13

Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start ***NR1***

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

10-Open .375" holes to .438" ***do not open fwd saddle holes***

11-Locate D3391-021 in D3391-023 at 9.00" (see view z-z)

12- Transfer drill one fwd saddle hole only to .188" dia, transfer drill all remaining fwd saddle holes using DT 8149 locating from previously drill .188" dia hole, using t-pins and clicos to ensure perfect allingment, open up previously transfer drilled pilot holes in D3391-023/-021 to 0.438" dia. in D3391-021

13- Using DT8217, locating from two previously drilled holes, drill remaining wearplate holes into D3391-021.

14- Locating from two fwd wearplate holes in D3391-023 drill remaining 6 wearplate holes in D3391-021 using DT8937

15- Open 10 wearplate holes in D3391-021 to 0.297" dia.

16- insert D3391-021 into D3391-23

17- insert T-pins into first and third fwd saddle holes

18- ON FIRST SIDE ONLY drill out 2nd and forth fwd saddles holes to 0.500" as per

19- ON 2ND SIDE ONLY ream out 2nd and forth saddle hole to 0.499".

20-Deburr and blow out all chips from inside tube, scribe batch # in D3391-023 at aft end.

- DC 13/05/08

- DC 13/05/08

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

| | | | | | | | | | | | | | | | | | | |
|--|---|---|--------------------------------------|------------------------------------|------------------------------------|--------------------------------------|------------------------------------|------------------------------------|--|----------------------------------|--|------------------------------------|--|--------------------------------|------------------------------------|------------------------------------|-----------------------------------|--|
| Work Order: _____ Part No. _____ NCR No. _____ | DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/> | AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table> | Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | |
| Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | | | | | | | | | | | | | | | | |

| Root Cause | Date | Step | Qty | Description of work order update or Non-conformance | Initial Chief Eng | Action Description | Sign & Date | Verification | QC Inspector |
|---------------|------|------|-----|---|-------------------|--------------------|-------------|--------------|--------------|
| Doc/Data | | | | | | | | | |
| Equip/Tooling | | | | | | | | | |
| Operator | | | | | | | | | |
| Material | | | | | | | | | |
| Setup | | | | | | | | | |
| Other | | | | | | | | | |
| Process | | | | | | | | | |
| Supplier | | | | | | | | | |
| Training | | | | | | | | | |
| Unapproved | | | | | | | | | |

FAULT CATEGORY

| Landing Gear | General | Other |
|---|---|--|
| <input type="checkbox"/> Bending | <input type="checkbox"/> Bend | <input type="checkbox"/> Grain |
| <input type="checkbox"/> Centre Not Concentric to O/S | <input type="checkbox"/> BOM/Route | <input type="checkbox"/> Hardware |
| <input type="checkbox"/> Cracks | <input type="checkbox"/> Broken/Damaged | <input type="checkbox"/> Inspection Incomplete |
| <input type="checkbox"/> Crushed/Crimped | <input type="checkbox"/> Burrs | <input type="checkbox"/> Instructions Incomplete/Unclear |
| <input type="checkbox"/> Cuffs | <input type="checkbox"/> Contamination | <input type="checkbox"/> Maintenance |
| <input type="checkbox"/> Heat Treat | <input type="checkbox"/> Countersink | <input type="checkbox"/> Mislabeled |
| <input type="checkbox"/> Inspection Strip in Tube | <input type="checkbox"/> Cut Too Short | <input type="checkbox"/> Misread |
| <input type="checkbox"/> Ripples in Bend | <input type="checkbox"/> Drill Holes | <input type="checkbox"/> Offset |
| <input type="checkbox"/> Torque Waves in Extrusion | <input type="checkbox"/> Drawing | <input type="checkbox"/> Out of Calibration |
| <input type="checkbox"/> Turning Sequence | <input type="checkbox"/> Finish | <input type="checkbox"/> Out of Sequence |
| <input type="checkbox"/> Wave/Twist in Tube | <input type="checkbox"/> Folio | <input type="checkbox"/> Outside Dimensions |
| | | <input type="checkbox"/> Ovalized |
| | | <input type="checkbox"/> Over/Under tolerance |
| | | <input type="checkbox"/> Part Incorrect |
| | | <input type="checkbox"/> Part Lost/Missing |
| | | <input type="checkbox"/> Part Moved |
| | | <input type="checkbox"/> Positioned Wrong |
| | | <input type="checkbox"/> Power Loss/Surge |
| | | <input type="checkbox"/> Pressure/Forced |
| | | <input type="checkbox"/> Temperature/Cure |
| | | <input type="checkbox"/> Weld |
| | | <input type="checkbox"/> Wrong Stock Pulled |
| | | <input type="checkbox"/> Other |

Work Order ID 98975

98975

Page 3

March-28-13 10:47:49 AM

Item ID: D3391-023

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Mid Tube Assembly

Start Date: 3/27/13 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 3/27/13 Req'd Qty: 1.00 ***1***

Customer:


Reference:


Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start ***NR1***

Stop ***NR2***

| Sequence ID/ Work Center ID | Operation Description | Set Up/ Run Hours | Tool ID | Tool # | Plan Code | Accept Qty | Reject Qty | Reject Number | Insp. Stamp |
|---|---|----------------------|---------|--|--------------|---------------|---------------|------------------|----------------|
| 110 *110* QC Quality Control | QC5- Inspect part completeness to step on W/O Memo | 0.00 0.00 | |  BS9 | | <u>1</u> | | | |
| 120 *120* HandFinish Hand Finishing | Chemical Conversion Coat per QSI005 4.1 Memo | 0.00 0.00 | | | | | | | |
| 130 *130* QC Quality Control | QC7-Inspect Chemical Conversion Coat Memo | 0.00 0.00 | | | | | | | |

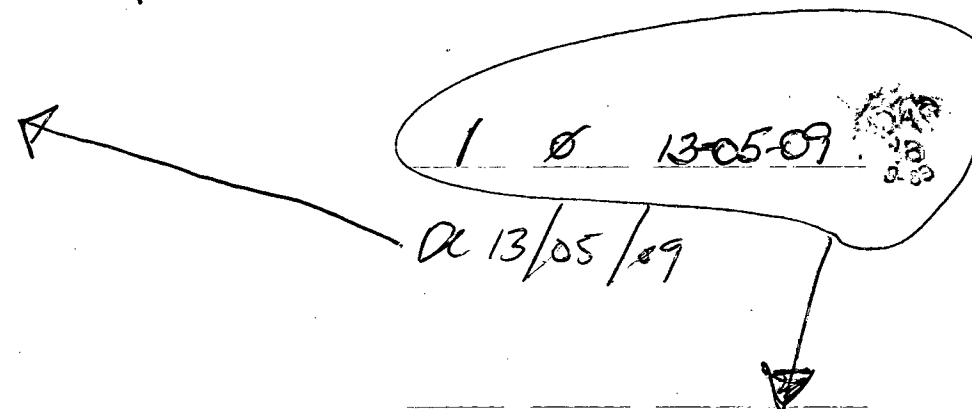

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

| | | | | | | | | | | | | | | | | | | |
|--|---|---|--------------------------------------|------------------------------------|------------------------------------|--------------------------------------|------------------------------------|------------------------------------|--|----------------------------------|--|------------------------------------|--|--------------------------------|------------------------------------|------------------------------------|-----------------------------------|--|
| Work Order: _____ Part No. _____ NCR No. _____ | DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/> | AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table> | Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | |
| Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | | | | | | | | | | | | | | | | |

| Root Cause | Date | Step | Qty | Description of work order update or Non-conformance | Initial Chief Eng | Action Description | Sign & Date | Verification | QC Inspector |
|---------------|------|------|-----|---|-------------------|--------------------|-------------|--------------|--------------|
| Doc/Data | | | | | | | | | |
| Equip/Tooling | | | | | | | | | |
| Operator | | | | | | | | | |
| Material | | | | | | | | | |
| Setup | | | | | | | | | |
| Other | | | | | | | | | |
| Process | | | | | | | | | |
| Supplier | | | | | | | | | |
| Training | | | | | | | | | |
| Unapproved | | | | | | | | | |

FAULT CATEGORY

| Landing Gear | General | Other |
|---|---|--|
| <input type="checkbox"/> Bending | <input type="checkbox"/> Bend | <input type="checkbox"/> Grain |
| <input type="checkbox"/> Centre Not Concentric to O/S | <input type="checkbox"/> BOM/Route | <input type="checkbox"/> Hardware |
| <input type="checkbox"/> Cracks | <input type="checkbox"/> Broken/Damaged | <input type="checkbox"/> Inspection Incomplete |
| <input type="checkbox"/> Crushed/Crimped | <input type="checkbox"/> Burrs | <input type="checkbox"/> Instructions Incomplete/Unclear |
| <input type="checkbox"/> Cuffs | <input type="checkbox"/> Contamination | <input type="checkbox"/> Maintenance |
| <input type="checkbox"/> Heat Treat | <input type="checkbox"/> Countersink | <input type="checkbox"/> Mislabelled |
| <input type="checkbox"/> Inspection Strip in Tube | <input type="checkbox"/> Cut Too Short | <input type="checkbox"/> Misread |
| <input type="checkbox"/> Ripples in Bend | <input type="checkbox"/> Drill Holes | <input type="checkbox"/> Offset |
| <input type="checkbox"/> Torque Waves in Extrusion | <input type="checkbox"/> Drawing | <input type="checkbox"/> Out of Calibration |
| <input type="checkbox"/> Turning Sequence | <input type="checkbox"/> Finish | <input type="checkbox"/> Out of Sequence |
| <input type="checkbox"/> Wave/Twist in Tube | <input type="checkbox"/> Folio | <input type="checkbox"/> Outside Dimensions |
| | | <input type="checkbox"/> Ovalized |
| | | <input type="checkbox"/> Over/Under tolerance |
| | | <input type="checkbox"/> Part Incorrect |
| | | <input type="checkbox"/> Part Lost/Missing |
| | | <input type="checkbox"/> Part Moved |
| | | <input type="checkbox"/> Positioned Wrong |
| | | <input type="checkbox"/> Power Loss/Surge |
| | | <input type="checkbox"/> Pressure/Forced |
| | | <input type="checkbox"/> Temperature/Cure |
| | | <input type="checkbox"/> Weld |
| | | <input type="checkbox"/> Wrong Stock Pulled |
| | | <input type="checkbox"/> Other |

Work Order ID 98975

98975

Page 4

March-28-13 10:47:49 AM

Item ID: D3391-023 Accept ***N900040100*** Setup Start ***NS1***
 Revision ID: Stop ***NS2***
 Item Name: Mid Tube Assembly
 Start Date: 3/27/13 Start Qty: 1.00 ***1*** Cust Item ID:
 Required Date: 3/27/13 Req'd Qty: 1.00 ***1*** Customer:
 Reference:

Approvals: Process Plan: Date: Tooling: Date: Run Start ***NR1***
 QC: Date: SPC (Y/N): Date: Stop ***NR2***

| Sequence ID/ Work Center ID | Operation Description | Set Up/ Run Hours | Tool ID | Tool # | Plan Code | Accept Qty | Reject Qty | Reject Number | Insp. Stamp |
|--------------------------------|---|----------------------|---------|--------|--------------|---------------|---------------|------------------|----------------|
| 140 | | 0.00 | | | | | | | |
| *140* | Skidtubes | | | | | | | | |
| Skidtubes | Memo | 0.00 | | | | | | | |
| Skidtubes | 1-Open float bag holes as per dwg 2-C'sink float bag holes as per dwg 3- Prepare tube for welding 4-Bond web in place as per Dwg D3391 & QSI 015. Adhere for 12 hours) A/R Sikaflex exp: <u>124988</u> 13/10/09 - DC 13/05/09 batch#: _____ - DC 13/05/09 NOTE:ENSURE WEB IS INSERTED IN AFT END OF TUBE | | | | | | | | |
| 150 | QC5- Inspect part completeness to step on W/O | 0.00 | | | | | | | |
| *150* | | | | | | | | | |
| QC | Memo | 0.00 | | | | | | | |
| Quality Control | | | | | | | | | |

DAS
18
9-8

1 8 13-05-13

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

| | | | | | | | | | | | | | | | | | | |
|--|---|--|--------------------------------------|------------------------------------|------------------------------------|--------------------------------------|------------------------------------|------------------------------------|--|----------------------------------|--|------------------------------------|--|--------------------------------|------------------------------------|------------------------------------|-----------------------------------|--|
| Work Order: _____ Part No. _____ NCR No. _____ | DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/> | AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="width:25%;">Skid-tube <input type="checkbox"/></td> <td style="width:25%;">Crosstube <input type="checkbox"/></td> <td style="width:25%;">Water Jet <input type="checkbox"/></td> <td style="width:25%;">Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table> | Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | |
| Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | | | | | | | | | | | | | | | | |

| Root Cause | Date | Step | Qty | Description of work order update or Non-conformance | Initial Chief Eng | Action Description | Sign & Date | Verification | QC Inspector |
|---------------|------|------|-----|---|-------------------|--------------------|-------------|--------------|--------------|
| Doc/Data | | | | | | | | | |
| Equip/Tooling | | | | | | | | | |
| Operator | | | | | | | | | |
| Material | | | | | | | | | |
| Setup | | | | | | | | | |
| Other | | | | | | | | | |
| Process | | | | | | | | | |
| Supplier | | | | | | | | | |
| Training | | | | | | | | | |
| Unapproved | | | | | | | | | |

FAULT CATEGORY

| Landing Gear | General | Other |
|---|---|--|
| <input type="checkbox"/> Bending | <input type="checkbox"/> Bend | <input type="checkbox"/> Grain |
| <input type="checkbox"/> Centre Not Concentric to O/S | <input type="checkbox"/> BOM/Route | <input type="checkbox"/> Hardware |
| <input type="checkbox"/> Cracks | <input type="checkbox"/> Broken/Damaged | <input type="checkbox"/> Inspection Incomplete |
| <input type="checkbox"/> Crushed/Crimped | <input type="checkbox"/> Burrs | <input type="checkbox"/> Instructions Incomplete/Unclear |
| <input type="checkbox"/> Cuffs | <input type="checkbox"/> Contamination | <input type="checkbox"/> Maintenance |
| <input type="checkbox"/> Heat Treat | <input type="checkbox"/> Countersink | <input type="checkbox"/> Mislabeled |
| <input type="checkbox"/> Inspection Strip in Tube | <input type="checkbox"/> Cut Too Short | <input type="checkbox"/> Misread |
| <input type="checkbox"/> Ripples in Bend | <input type="checkbox"/> Drill Holes | <input type="checkbox"/> Offset |
| <input type="checkbox"/> Torque Waves in Extrusion | <input type="checkbox"/> Drawing | <input type="checkbox"/> Out of Calibration |
| <input type="checkbox"/> Turning Sequence | <input type="checkbox"/> Finish | <input type="checkbox"/> Out of Sequence |
| <input type="checkbox"/> Wave/Twist in Tube | <input type="checkbox"/> Folio | <input type="checkbox"/> Outside Dimensions |
| | | <input type="checkbox"/> Ovalized |
| | | <input type="checkbox"/> Over/Under tolerance |
| | | <input type="checkbox"/> Part Incorrect |
| | | <input type="checkbox"/> Part Lost/Missing |
| | | <input type="checkbox"/> Part Moved |
| | | <input type="checkbox"/> Positioned Wrong |
| | | <input type="checkbox"/> Power Loss/Surge |
| | | <input type="checkbox"/> Pressure/Forced |
| | | <input type="checkbox"/> Temperature/Cure |
| | | <input type="checkbox"/> Weld |
| | | <input type="checkbox"/> Wrong Stock Pulled |
| | | <input type="checkbox"/> Other |

Work Order ID 98975

98975

Page 5

March-28-13 10:47:49 AM

Item ID: D3391-023 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: Stop ***NS2***
Item Name: Mid Tube Assembly
Start Date: 3/27/13 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 3/27/13 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

| Sequence ID/ Work Center ID | Operation Description | Set Up/ Run Hours | Tool ID | Tool # | Plan Code | Accept Qty | Reject Qty | Reject Number | Insp. Stamp |
|----------------------------------|--|----------------------|---------|--------|--------------|---------------|---------------|------------------|----------------|
| 160 *160* Skidtubes | Skidtubes | 0.00 | | | | 1 | 0 | | BE 13/05/13 |
| | Memo | 0.00 | | | | | | | |
| | 1-Weld crossbolt spacer as per dwg D3391 & QSI 004 | | | | | | | | A/R M125127 |
| | 2-grind weld flush | | | | | | | | |
| 170 *170* QC | QC10- Inspect visual per QSI004- ground welds | 0.00 | | | | | | | |
| | Memo | 0.00 | | | | | | | BS 14 |
| 180 *180* QC | QC5- Inspect part completeness to step on W/O | 0.00 | | | | | | | |
| | Memo | 0.00 | | | | | | | BS 14 |

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

| | | | | | | | | | | | | | | | | | | |
|--|---|---|--------------------------------------|------------------------------------|------------------------------------|--------------------------------------|------------------------------------|------------------------------------|--|----------------------------------|--|------------------------------------|--|--------------------------------|------------------------------------|------------------------------------|-----------------------------------|--|
| Work Order: _____ Part No. _____ NCR No. _____ | DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/> | AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table> | Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | |
| Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | | | | | | | | | | | | | | | | |

| Root Cause | Date | Step | Qty | Description of work order update or Non-conformance | Initial Chief Eng | Action Description | Sign & Date | Verification | QC Inspector |
|--|------|------|-----|---|-------------------|--------------------|-------------|--------------|--------------|
| Doc/Data <input type="checkbox"/> | | | | | | | | | |
| Equip/Tooling <input type="checkbox"/> | | | | | | | | | |
| Operator <input type="checkbox"/> | | | | | | | | | |
| Material <input type="checkbox"/> | | | | | | | | | |
| Setup <input type="checkbox"/> | | | | | | | | | |
| Other <input type="checkbox"/> | | | | | | | | | |
| Process <input type="checkbox"/> | | | | | | | | | |
| Supplier <input type="checkbox"/> | | | | | | | | | |
| Training <input type="checkbox"/> | | | | | | | | | |
| Unapproved <input type="checkbox"/> | | | | | | | | | |

FAULT CATEGORY

| | | |
|---|---|---|
| Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube | General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio | <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions |
|---|---|---|

| | |
|--|---|
| <input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge | <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other |
|--|---|

Work Order ID 98975

98975

Page 6

March-28-13 10:47:49 AM

Item ID: D3391-023 Accept *N900040100* Setup Start *NS1*
 Revision ID: Stop *NS2*
 Item Name: Mid Tube Assembly
 Start Date: 3/27/13 Start Qty: 1.00 *1* Cust Item ID:
 Required Date: 3/27/13 Req'd Qty: 1.00 *1* Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start *NR1*
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop *NR2*

| Sequence ID/ Work Center ID | Operation Description | Set Up/ Run Hours | Tool ID | Tool # | Plan Code | Accept Qty | Reject Qty | Reject Number | Insp. Stamp |
|--------------------------------|--------------------------|----------------------|---------|--------|--------------|---------------|---------------|------------------|----------------|
|--------------------------------|--------------------------|----------------------|---------|--------|--------------|---------------|---------------|------------------|----------------|

| | | | | | | | | | |
|----------------|--------------------------------|------|--|--|--|--|--|--|--|
| 185 | Pressure Wash per QSI005 4.3 | 0.00 | | | | | | | |
| *185* | | | | | | | | | |
| HandFinish | Memo | 0.00 | | | | | | | |
| Hand Finishing | AND REALODINE AS PER PAR09-043 | | | | | | | | |

1X p m / 13/05/21

| | | | | | | | | | |
|----------------|--|------|--|--|--|--|--|--|--|
| 190 | White Gloss(Ref:4.3.5.1) per QSI005 4.3-Alum | 0.00 | | | | | | | |
| *190* | | | | | | | | | |
| Powdercoat | Memo | 0.00 | | | | | | | |
| Powder Coating | START TIME: 10:40 | | | | | | | | |
| | OVEN TEMPERATURE: 320°F | | | | | | | | |
| | FINISH TIME: 11:10 | | | | | | | | |

1X y m / 13/05/21

| | | | | | | | | | |
|-----------------|--------------------------|------|--|--|--|--|--|--|--|
| 200 | QC3- Inspect Part Finish | 0.00 | | | | | | | |
| *200* | | | | | | | | | |
| QC | Memo | 0.00 | | | | | | | |
| Quality Control | | | | | | | | | |

1X d m / 13/05/27

m125620

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

| | | | | | | | | | | | | | | | | | | |
|--|---|---|--------------------------------------|------------------------------------|------------------------------------|--------------------------------------|------------------------------------|------------------------------------|--|----------------------------------|--|------------------------------------|--|--------------------------------|------------------------------------|------------------------------------|-----------------------------------|--|
| Work Order: _____ Part No. _____ NCR No. _____ | DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/> | AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table> | Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | |
| Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | | | | | | | | | | | | | | | | |

| Root Cause | Date | Step | Qty | Description of work order update or Non-conformance | Initial Chief Eng | Action Description | Sign & Date | Verification | QC Inspector |
|--|------|------|-----|---|-------------------|--------------------|-------------|--------------|--------------|
| Doc/Data <input type="checkbox"/> | | | | | | | | | |
| Equip/Tooling <input type="checkbox"/> | | | | | | | | | |
| Operator <input type="checkbox"/> | | | | | | | | | |
| Material <input type="checkbox"/> | | | | | | | | | |
| Setup <input type="checkbox"/> | | | | | | | | | |
| Other <input type="checkbox"/> | | | | | | | | | |
| Process <input type="checkbox"/> | | | | | | | | | |
| Supplier <input type="checkbox"/> | | | | | | | | | |
| Training <input type="checkbox"/> | | | | | | | | | |
| Unapproved <input type="checkbox"/> | | | | | | | | | |

FAULT CATEGORY

| | | |
|---|---|---|
| Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube | General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio | <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions |
| | | <input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge |
| | | <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other |

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

| | | | | | | | | | | | | | | | | | | |
|--|---|---|--------------------------------------|------------------------------------|------------------------------------|--------------------------------------|------------------------------------|------------------------------------|--|----------------------------------|--|------------------------------------|--|--------------------------------|------------------------------------|------------------------------------|-----------------------------------|--|
| Work Order: _____ Part No. _____ NCR No. _____ | DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/> | AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table> | Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | |
| Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | | | | | | | | | | | | | | | | |

| Root Cause | Date | Step | Qty | Description of work order update or Non-conformance | Initial Chief Eng | Action Description | Sign & Date | Verification | QC Inspector |
|---------------|------|------|-----|---|-------------------|--------------------|-------------|--------------|--------------|
| Doc/Data | | | | | | | | | |
| Equip/Tooling | | | | | | | | | |
| Operator | | | | | | | | | |
| Material | | | | | | | | | |
| Setup | | | | | | | | | |
| Other | | | | | | | | | |
| Process | | | | | | | | | |
| Supplier | | | | | | | | | |
| Training | | | | | | | | | |
| Unapproved | | | | | | | | | |

FAULT CATEGORY

| Landing Gear | General | Other |
|---|---|--|
| <input type="checkbox"/> Bending | <input type="checkbox"/> Bend | <input type="checkbox"/> Grain |
| <input type="checkbox"/> Centre Not Concentric to O/S | <input type="checkbox"/> BOM/Route | <input type="checkbox"/> Hardware |
| <input type="checkbox"/> Cracks | <input type="checkbox"/> Broken/Damaged | <input type="checkbox"/> Inspection Incomplete |
| <input type="checkbox"/> Crushed/Crimped | <input type="checkbox"/> Burrs | <input type="checkbox"/> Instructions Incomplete/Unclear |
| <input type="checkbox"/> Cuffs | <input type="checkbox"/> Contamination | <input type="checkbox"/> Maintenance |
| <input type="checkbox"/> Heat Treat | <input type="checkbox"/> Countersink | <input type="checkbox"/> Mislabeled |
| <input type="checkbox"/> Inspection Strip in Tube | <input type="checkbox"/> Cut Too Short | <input type="checkbox"/> Misread |
| <input type="checkbox"/> Ripples in Bend | <input type="checkbox"/> Drill Holes | <input type="checkbox"/> Offset |
| <input type="checkbox"/> Torque Waves in Extrusion | <input type="checkbox"/> Drawing | <input type="checkbox"/> Out of Calibration |
| <input type="checkbox"/> Turning Sequence | <input type="checkbox"/> Finish | <input type="checkbox"/> Out of Sequence |
| <input type="checkbox"/> Wave/Twist in Tube | <input type="checkbox"/> Folio | <input type="checkbox"/> Outside Dimensions |
| | | <input type="checkbox"/> Ovalized |
| | | <input type="checkbox"/> Over/Under tolerance |
| | | <input type="checkbox"/> Part Incorrect |
| | | <input type="checkbox"/> Part Lost/Missing |
| | | <input type="checkbox"/> Part Moved |
| | | <input type="checkbox"/> Positioned Wrong |
| | | <input type="checkbox"/> Power Loss/Surge |
| | | <input type="checkbox"/> Pressure/Forced |
| | | <input type="checkbox"/> Temperature/Cure |
| | | <input type="checkbox"/> Weld |
| | | <input type="checkbox"/> Wrong Stock Pulled |
| | | <input type="checkbox"/> Other |

Work Order ID 98975***98975***

Page 8

March-28-13 10:47:50 AM

Item ID: D3391-023

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Mid Tube Assembly

Start Date: 3/27/13

Start Qty: 1.00

1

Cust Item ID:

Required Date: 3/27/13

Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan: _____

Date: _____

Tooling: _____

Date: _____

Run Start ***NR1***

QC: _____

Date: _____

SPC (Y/N): _____

Date: _____

Stop ***NR2***Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

260

QC21- Final Inspection - Work Order Release

0.00

260

QC

Memo

0.00

Quality Control

13/5/29

MF

13-5-29

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

| | | | | | | | | | | | | | | | | | | |
|--|---|---|--------------------------------------|------------------------------------|------------------------------------|--------------------------------------|------------------------------------|------------------------------------|--|----------------------------------|--|------------------------------------|--|--------------------------------|------------------------------------|------------------------------------|-----------------------------------|--|
| Work Order: _____ Part No. _____ NCR No. _____ | DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/> | AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table> | Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | |
| Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | | | | | | | | | | | | | | | | |

| Root Cause | Date | Step | Qty | Description of work order update or Non-conformance | Initial Chief Eng | Action Description | Sign & Date | Verification | QC Inspector |
|---------------|------|------|-----|---|-------------------|--------------------|-------------|--------------|--------------|
| Doc/Data | | | | | | | | | |
| Equip/Tooling | | | | | | | | | |
| Operator | | | | | | | | | |
| Material | | | | | | | | | |
| Setup | | | | | | | | | |
| Other | | | | | | | | | |
| Process | | | | | | | | | |
| Supplier | | | | | | | | | |
| Training | | | | | | | | | |
| Unapproved | | | | | | | | | |

FAULT CATEGORY

| Landing Gear | General | Other |
|---|---|--|
| <input type="checkbox"/> Bending | <input type="checkbox"/> Bend | <input type="checkbox"/> Grain |
| <input type="checkbox"/> Centre Not Concentric to O/S | <input type="checkbox"/> BOM/Route | <input type="checkbox"/> Hardware |
| <input type="checkbox"/> Cracks | <input type="checkbox"/> Broken/Damaged | <input type="checkbox"/> Inspection Incomplete |
| <input type="checkbox"/> Crushed/Crimped | <input type="checkbox"/> Burrs | <input type="checkbox"/> Instructions Incomplete/Unclear |
| <input type="checkbox"/> Cuffs | <input type="checkbox"/> Contamination | <input type="checkbox"/> Maintenance |
| <input type="checkbox"/> Heat Treat | <input type="checkbox"/> Countersink | <input type="checkbox"/> Mislabeled |
| <input type="checkbox"/> Inspection Strip in Tube | <input type="checkbox"/> Cut Too Short | <input type="checkbox"/> Misread |
| <input type="checkbox"/> Ripples in Bend | <input type="checkbox"/> Drill Holes | <input type="checkbox"/> Offset |
| <input type="checkbox"/> Torque Waves in Extrusion | <input type="checkbox"/> Drawing | <input type="checkbox"/> Out of Calibration |
| <input type="checkbox"/> Turning Sequence | <input type="checkbox"/> Finish | <input type="checkbox"/> Out of Sequence |
| <input type="checkbox"/> Wave/Twist in Tube | <input type="checkbox"/> Folio | <input type="checkbox"/> Outside Dimensions |
| | | <input type="checkbox"/> Ovalized |
| | | <input type="checkbox"/> Over/Under tolerance |
| | | <input type="checkbox"/> Part Incorrect |
| | | <input type="checkbox"/> Part Lost/Missing |
| | | <input type="checkbox"/> Part Moved |
| | | <input type="checkbox"/> Positioned Wrong |
| | | <input type="checkbox"/> Power Loss/Surge |
| | | <input type="checkbox"/> Pressure/Forced |
| | | <input type="checkbox"/> Temperature/Cure |
| | | <input type="checkbox"/> Weld |
| | | <input type="checkbox"/> Wrong Stock Pulled |
| | | <input type="checkbox"/> Other |

Picklist Print

March-28-13 10:47:49 AM

Page 1

Work Order ID: 98975

Parent Item: D3391-023

Parent Item Name: Mid Tube Assembly

Start Date: 3/27/13

Required Date: 3/27/13

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP A05.10.20New Issue KJ/EC
 IPP B06.02.10ECN773 dwg rev.D EC
 IPP C 07.03.20 rev F dwg EC
 IPP D 07.03.28 re-format EC
 IPP E 07.10.31 ecn 1053P EC
 IPP Rev:F ECN 1056 07-11-13 DD verified by: EC
 IPP Rev:G 08-09-08 new process (ecn 08-510) DD verified by:EC
 IPP Rev:H 08-09-10 revH as per dwg DD verified by:EC
 IPP Rev: I 08-11-13 Removed steps per w/o, QC KJ verified by: ec IPP Rev:J add in seq 140
 expire date &b# sikaflex DD 10.02.17 verified by:EC

| Component Item ID/ Item Name | Replacement Item ID | Mfg/ Purch | Bin Item | Primary Location | Last Location | Route Seq ID | Unit of Measure | Qty on Hand | Qty per Kit | Total Qty | Qty Issued | Date Issued | Status |
|-----------------------------------|------------------------|---------------|-------------|---------------------|------------------|-----------------|--------------------|-----------------|-------------|--------------|---------------|----------------|--------|
| D2500-1-100 Skidtube Extrusion | | Manufactured | No | | | 100 | Each | 132.0000 | 1 | | | DC 13/05/08 | |
| | | | | <u>Location /</u> | | <u>Loc Qty</u> | | <u>Loc Code</u> | | | | | |
| | | | | HALL | | 132 | | | | | | | |
| | | | | 82372 | | 45 | | | | | | | |
| | | | | 86065 | | 87 | | | | | | | |
| D3391-021 Fwd Tube Assembly | | Manufactured | No | | | 100 | Each | 0.0000 | 1 | | | DC 13/05/08 | |
| D3389-1 Web | | Manufactured | No | | | 140 | Each | 6.0000 | 1 | | | DC 13/05/09 | |
| | | | | <u>Location</u> | | <u>Loc Qty</u> | | <u>Loc Code</u> | | | | | |
| | | | | LG | | 6 | | | | | | | |
| | | | | 85508 | | 1 | | | | | | | |
| | | | | 94991 | | 1 | | | | | | | |
| | | | | 97792 | | 4 | | | | | | | |

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

| | | | | | | | | | | | | | | | | | | |
|--|---|---|--------------------------------------|------------------------------------|------------------------------------|--------------------------------------|------------------------------------|------------------------------------|--|----------------------------------|--|------------------------------------|--|--------------------------------|------------------------------------|------------------------------------|-----------------------------------|--|
| Work Order: _____ Part No. _____ NCR No. _____ | DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/> | AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table> | Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | |
| Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | | | | | | | | | | | | | | | | |

| Root Cause | Date | Step | Qty | Description of work order update or Non-conformance | Initial Chief Eng | Action Description | Sign & Date | Verification | QC Inspector |
|--|------|------|-----|---|-------------------|--------------------|-------------|--------------|--------------|
| Doc/Data <input type="checkbox"/> | | | | | | | | | |
| Equip/Tooling <input type="checkbox"/> | | | | | | | | | |
| Operator <input type="checkbox"/> | | | | | | | | | |
| Material <input type="checkbox"/> | | | | | | | | | |
| Setup <input type="checkbox"/> | | | | | | | | | |
| Other <input type="checkbox"/> | | | | | | | | | |
| Process <input type="checkbox"/> | | | | | | | | | |
| Supplier <input type="checkbox"/> | | | | | | | | | |
| Training <input type="checkbox"/> | | | | | | | | | |
| Unapproved <input type="checkbox"/> | | | | | | | | | |

FAULT CATEGORY

| | | |
|---|---|---|
| Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube | General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio | <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions |
|---|---|---|

| | | |
|--|---|--|
| <input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge | <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other | |
|--|---|--|

Picklist Print

March-28-13 10:47:49 AM

Page 2

Work Order ID: 98975

Parent Item: D3391-023

Parent Item Name: Mid Tube Assembly

Start Date: 3/27/13

Required Date: 3/27/13

Start Qty: 1.00

Required Qty: 1.00

D3681-1 Manufactured No
Spacer

160 Each 124.0000 5 5

BE 13/05/13

Location Loc Qty Loc Code

LG 81

(93371) 81

LG001 10

68958 2

69893 2

71845 2

74874 1

76004 1

77501 2

LG005 33

80361 1

87611 2

(94752) 30

D3591-1 Manufactured No
Bushing

Each 44.0000

4

u 2

13/05/27

Location Loc Qty Loc Code

FG 10

92873 10

FP001 5

80377 4

82027 1

FP002 1

57350 1

GA 28

83237 28

B100699

x2

March-28-13 10:47:49 AM

Shop Packet Print

Page 2

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

| | | | | | | | | | | | | | | | | | | |
|--|---|---|--------------------------------------|------------------------------------|------------------------------------|--------------------------------------|------------------------------------|------------------------------------|--|----------------------------------|--|------------------------------------|--|--------------------------------|------------------------------------|------------------------------------|-----------------------------------|--|
| Work Order: _____ Part No. _____ NCR No. _____ | DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/> | AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table> | Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | |
| Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | | | | | | | | | | | | | | | | |

| Root Cause | Date | Step | Qty | Description of work order update or Non-conformance | Initial Chief Eng | Action Description | Sign & Date | Verification | QC Inspector |
|--|------|------|-----|---|-------------------|--------------------|-------------|--------------|--------------|
| Doc/Data <input type="checkbox"/> | | | | | | | | | |
| Equip/Tooling <input type="checkbox"/> | | | | | | | | | |
| Operator <input type="checkbox"/> | | | | | | | | | |
| Material <input type="checkbox"/> | | | | | | | | | |
| Setup <input type="checkbox"/> | | | | | | | | | |
| Other <input type="checkbox"/> | | | | | | | | | |
| Process <input type="checkbox"/> | | | | | | | | | |
| Supplier <input type="checkbox"/> | | | | | | | | | |
| Training <input type="checkbox"/> | | | | | | | | | |
| Unapproved <input type="checkbox"/> | | | | | | | | | |

FAULT CATEGORY

| | | |
|---|---|---|
| Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube | General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio | <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions |
|---|---|---|

| | |
|--|---|
| <input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge | <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other |
|--|---|

Picklist Print

March-28-13 10:47:49 AM

Page 3

Work Order ID: 98975
Parent Item: D3391-023
Parent Item Name: Mid Tube Assembly

Start Date: 3/27/13

Required Date: 3/27/13

Start Qty: 1.00

Required Qty: 1.00

ALS4-1032-130
Insert

Purchased

No

230

Each

7,620.0000

20

20

13/05/27

Location

Loc Qty

Loc Code

FP001

389

119084

116

120671

89

120807

36

120837

8

121269

140

ST279

544

124080

544

st510

6687

124163

6687

X 20

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____


QA Closed: _____ Date: _____

| | | | | | | | | | | | | | | | | | | |
|--|---|---|--------------------------------------|------------------------------------|------------------------------------|--------------------------------------|------------------------------------|------------------------------------|--|----------------------------------|--|------------------------------------|--|--------------------------------|------------------------------------|------------------------------------|-----------------------------------|--|
| Work Order: _____ Part No. _____ NCR No. _____ | DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/> | AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table> | Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | |
| Skid-tube <input type="checkbox"/> | Crosstube <input type="checkbox"/> | Water Jet <input type="checkbox"/> | Engineering <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Machining <input type="checkbox"/> | Small Fab <input type="checkbox"/> | Prod. Eng. Coord. <input type="checkbox"/> | Quality <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Thermoforming <input type="checkbox"/> | Finishing <input type="checkbox"/> | Rec/Store/Packaging <input type="checkbox"/> | Other <input type="checkbox"/> | | | | | | | | | | | | | | | |
| Large Fab <input type="checkbox"/> | Composite <input type="checkbox"/> | Supplier <input type="checkbox"/> | | | | | | | | | | | | | | | | |

| Root Cause | Date | Step | Qty | Description of work order update or Non-conformance | Initial Chief Eng | Action Description | Sign & Date | Verification | QC Inspector |
|---------------|------|------|-----|---|-------------------|--------------------|-------------|--------------|--------------|
| Doc/Data | | | | | | | | | |
| Equip/Tooling | | | | | | | | | |
| Operator | | | | | | | | | |
| Material | | | | | | | | | |
| Setup | | | | | | | | | |
| Other | | | | | | | | | |
| Process | | | | | | | | | |
| Supplier | | | | | | | | | |
| Training | | | | | | | | | |
| Unapproved | | | | | | | | | |

FAULT CATEGORY

| Landing Gear | General | Other |
|---|---|--|
| <input type="checkbox"/> Bending | <input type="checkbox"/> Bend | <input type="checkbox"/> Grain |
| <input type="checkbox"/> Centre Not Concentric to O/S | <input type="checkbox"/> BOM/Route | <input type="checkbox"/> Hardware |
| <input type="checkbox"/> Cracks | <input type="checkbox"/> Broken/Damaged | <input type="checkbox"/> Inspection Incomplete |
| <input type="checkbox"/> Crushed/Crimped | <input type="checkbox"/> Burrs | <input type="checkbox"/> Instructions Incomplete/Unclear |
| <input type="checkbox"/> Cuffs | <input type="checkbox"/> Contamination | <input type="checkbox"/> Maintenance |
| <input type="checkbox"/> Heat Treat | <input type="checkbox"/> Countersink | <input type="checkbox"/> Mislabelled |
| <input type="checkbox"/> Inspection Strip in Tube | <input type="checkbox"/> Cut Too Short | <input type="checkbox"/> Misread |
| <input type="checkbox"/> Ripples in Bend | <input type="checkbox"/> Drill Holes | <input type="checkbox"/> Offset |
| <input type="checkbox"/> Torque Waves in Extrusion | <input type="checkbox"/> Drawing | <input type="checkbox"/> Out of Calibration |
| <input type="checkbox"/> Turning Sequence | <input type="checkbox"/> Finish | <input type="checkbox"/> Out of Sequence |
| <input type="checkbox"/> Wave/Twist in Tube | <input type="checkbox"/> Folio | <input type="checkbox"/> Outside Dimensions |
| | | <input type="checkbox"/> Ovalized |
| | | <input type="checkbox"/> Over/Under tolerance |
| | | <input type="checkbox"/> Part Incorrect |
| | | <input type="checkbox"/> Part Lost/Missing |
| | | <input type="checkbox"/> Part Moved |
| | | <input type="checkbox"/> Positioned Wrong |
| | | <input type="checkbox"/> Power Loss/Surge |
| | | <input type="checkbox"/> Pressure/Forced |
| | | <input type="checkbox"/> Temperature/Cure |
| | | <input type="checkbox"/> Weld |
| | | <input type="checkbox"/> Wrong Stock Pulled |
| | | <input type="checkbox"/> Other |

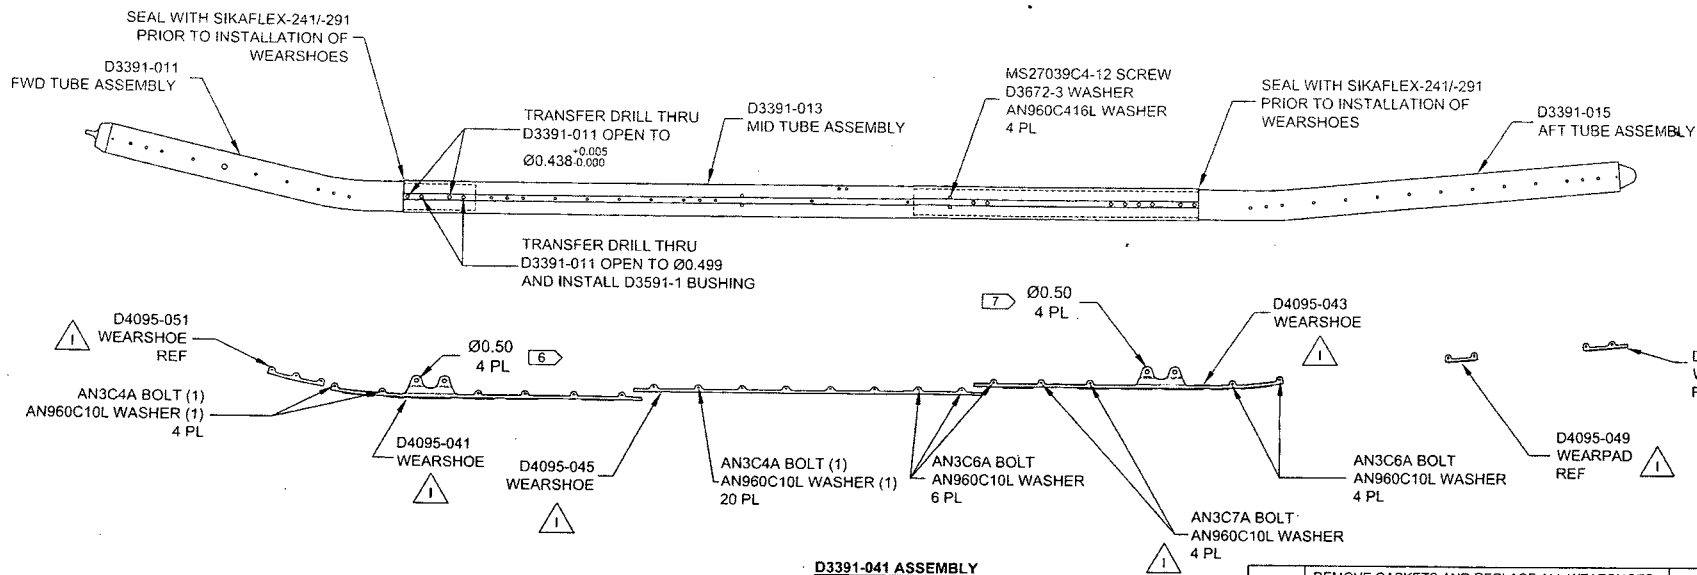

D3391-041 FLOAT SKIDTUBE ASSEMBLY PARTS LIST

| QTY -041 | PART NUMBER | DESCRIPTION |
|-------------|--------------|-------------------------|
| X | D3391-041 | FLOAT SKIDTUBE ASSEMBLY |
| 1 | D3391-011 | FWD TUBE ASSEMBLY |
| 1 | D3391-013 | MID TUBE ASSEMBLY |
| 1 | D3391-015 | AFT TUBE ASSEMBLY |
| 2 | D3591-1 | BUSHING |
| 4 | D3672-3 | WASHER |
| 1 | D4095-041 | WEARSHOE |
| 1 | D4095-043 | WEARSHOE |
| 1 | D4095-045 | WEARSHOE |
| 1 | D4095-047 | WEARPAD |
| 1 | D4095-049 | WEARPAD |
| 1 | D4095-051 | WEARSHOE |
| 24 | AN3C4A | BOLT |
| 10 | AN3C6A | BOLT |
| 4 | AN3C7A | BOLT |
| 38 | AN960C10L | WASHER |
| 4 | MS27039C4-12 | SCREW |
| 4 | AN960C416L | WASHER |

GENERAL NOTES

- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1 POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 SIZE HOLES FOR WEARSHOE INSERTS. C'BORE AS NOTED AND INSTALL INSERTS EXCEPT WHERE INDICATED.
- 6) FIT D4095-041 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND TRANSFER DRILL Ø0.50 HOLES FROM SADDLE TO D4095-041
- 7) FIT D4095-043 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH THE APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND TRANSFER DRILL Ø0.50 HOLES FROM SADDLE TO D4095-043


RELEASED
2011-11-04
ECN#11-662

| | | | |
|------------|--|--|--------------|
| I | REMOVE GASKETS AND REPLACE ALL WEARSHOES; PARTS LIST UPDATE, ZN A8-1, ZN A8-2, ZN A6-4, ZN B6-8, LPS-3 COATING REMOVED FROM NOTE 2, ZN A3-1, ZN A3-2, REMOVED INSERT AELS-1032-130, ZN B6-4, B2-4, C7-8, C3-8; REMOVED HOLES, ZN D6-4 ZN D2-4, ZN D7-8, ZN D3-8 | XDF | 11.10.13 |
| H | DRAWING UPDATED TO CURRENT STANDARDS. SHT 1 PL ADDED D3591-1 BUSHING. ZN C6 Ø0.438 DIM WAS 4 PL. ADDED Ø0.499 DIM AND D3591-1 BUSHING. SHT 2 PL ADDED D3591-1 BUSHING. ZN C6 Ø0.438 DIM WAS 4 PL. ADDED Ø0.499 DIM AND D3591-1 BUSHING. (FOR FURTHER INFO SEE DSI 9364 & NCR 08-074) | AJS | 08.08.20 |
| G | REPLACE NAS INSERTS W/ AELS INSERTS SWITCH TO D3670-XXXX SPACERS FOR INSTALLING FLOAT BAGS, DWG REORGANIZED FOR CLARITY | DC | 07.07.31 |
| F | ADD SS WEARSHOE, GASKET REMOVE FWD SADDLE HOLE -011/-021 | PH | 07.01.18 |
| E | CHANGE TOLERANCE, EASE MANUFACTURE | PH | 06.04.25 |
| D | UPDATE TOLERANCE, CHANGE HOLE SIZE | PH | 06.01.23 |
| C | LENGTHEN AFT EXTENSION | PH | 05.09.27 |
| B | DRAWING UPDATES | PH | 05.06.10 |
| A | NEW ISSUE | PH | 05.02.07 |
| REV. | DESCRIPTION | BY | DATE |
| DESIGN | PH | DART AEROSPACE USA, INC KENT, WA | |
| DRAWN | XDF | | |
| CHECKED | | DRAWING NO. | REV. 1 |
| MFG. APPR. | | D3391 | SHEET 1 OF 8 |
| APPROVED | | TITLE | SCALE |
| DE APPR. | | 412 FLOAT SKIDTUBE | NTS |
| DATE | 11.10.13 | COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC. | |

UNCONTROLLED COPY
NO AMENDMENT
13-04-01

98975 MLS
13-04-01

98975

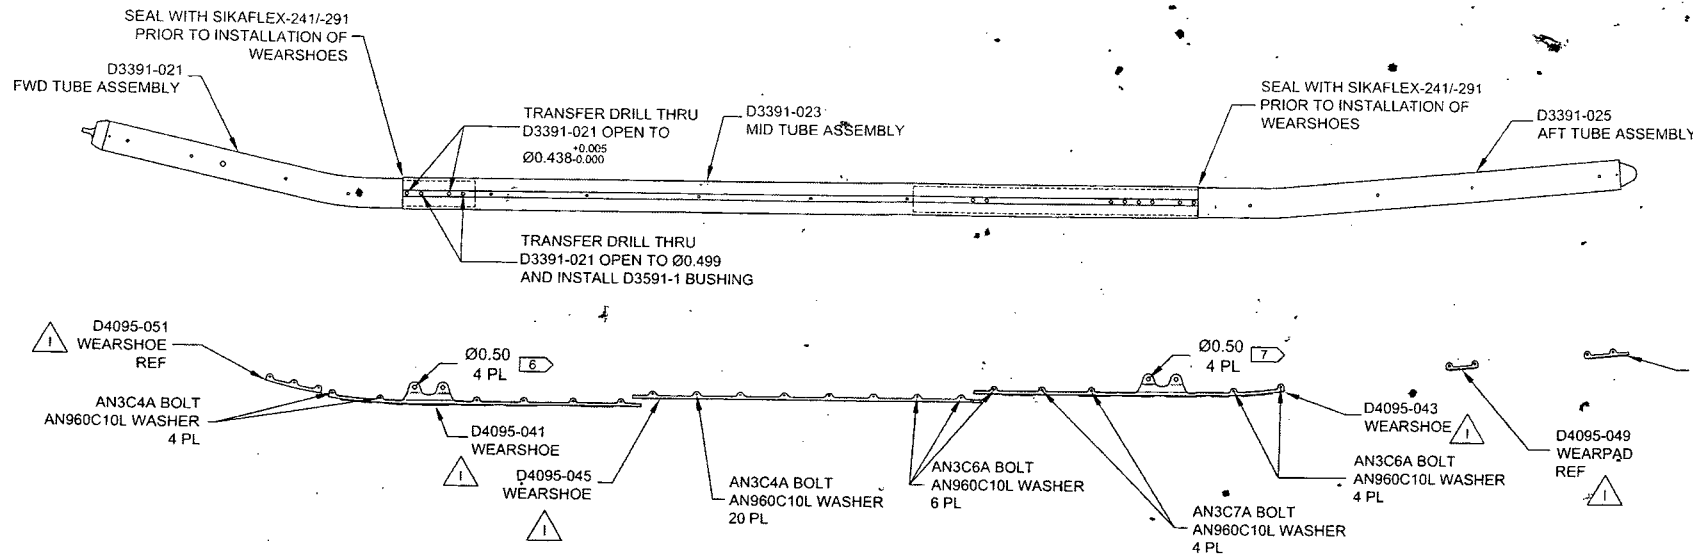

D3391-043 ASSEMBLY

D3391-043 FLOAT SKIDTUBE ASSEMBLY PARTS LIST

| QTY -043 | PART NUMBER | DESCRIPTION |
|-------------|-------------|-------------------------|
| X | D3391-043 | FLOAT SKIDTUBE ASSEMBLY |
| 1 | D3391-021 | FWD TUBE ASSEMBLY |
| 1 | D3391-023 | MID TUBE ASSEMBLY |
| 1 | D3391-025 | AFT TUBE ASSEMBLY |
| 2 | D3591-1 | BUSHING |
| 1 | D4095-041 | WEARSHOE |
| 1 | D4095-043 | WEARSHOE |
| 1 | D4095-045 | WEARSHOE |
| 1 | D4095-047 | WEARPAD |
| 1 | D4095-049 | WEARPAD |
| 1 | D4095-051 | WEARSHOE |
| 24 | AN3C4A | BOLT |
| 10 | AN3C6A | BOLT |
| 4 | AN3C7A | BOLT |
| 38 | AN960C10L | WASHER |


GENERAL NOTES

- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON"
- 3) AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
- 4) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 5) UNITS: INCHES UNLESS OTHERWISE NOTED
- 6) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 SIZE HOLES FOR WEARSHOE INSERTS. C'BORE AS NOTED AND INSTALL INSERTS EXCEPT WHERE INDICATED.
- 7) FIT D4095-041 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND TRANSFER DRILL Ø0.50 HOLES FROM SADDLE TO D4095-041
- 8) FIT D4095-043 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH THE APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND TRANSFER DRILL Ø0.50 HOLES FROM SADDLE TO D4095-043


RELEASED
2011-11-04

| | | | |
|------------|----------|--|--------------|
| DESIGN | PH | DART AEROSPACE USA, INC | |
| DRAWN | XDF | KENT, WA | |
| CHECKED | | DRAWING NO. | REV. 1 |
| MFG. APPR. | | D3391 | SHEET 2 OF 8 |
| APPROVED | | TITLE | SCALE |
| DE APPR. | | 412 FLOAT SKIDTUBE | NTS |
| DATE | 11.10.13 | COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC. | |


98975

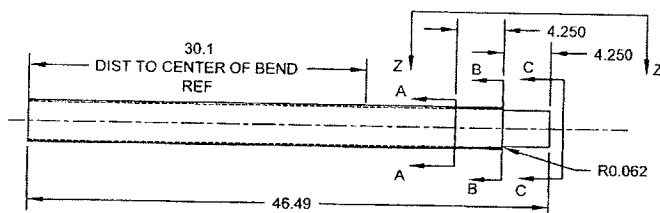


D3391-1 CUTTING DETAIL
(MAKE FROM D6013-047 SKIDTUBE MATERIAL)

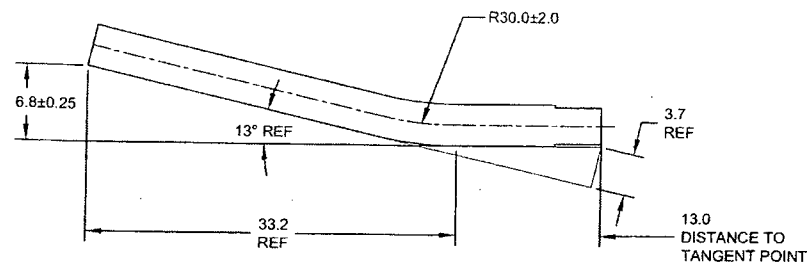


D3391-011/-021 BENDING DETAIL
(MAKE FROM D3391-1)

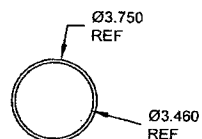


SECTION A-A
SCALE 2X

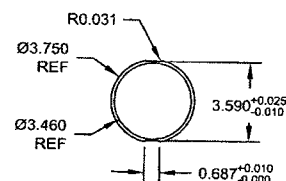

SECTION B-B
SCALE 2X

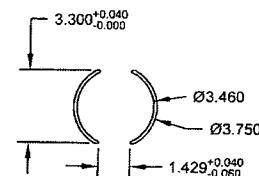

SECTION C-C
SCALE 2X



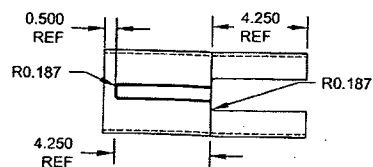


VIEW Z-Z
SCALE 2X

RELEASED
2011-11-04


| | | | |
|------------|----------|--|--------------|
| DESIGN | PH | DART AEROSPACE USA, INC | |
| DRAWN | XDF | KENT, WA | |
| CHECKED | | DRAWING NO. | REV. 1 |
| MFG. APPR. | | D3391 | SHEET 3 OF 8 |
| APPROVED | | TITLE | SCALE |
| DE APPR. | | 412 FLOAT SKIDTUBE | NTS |
| DATE | 11.10.13 | <small>COPYRIGHT © 2013 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small> | |

98975

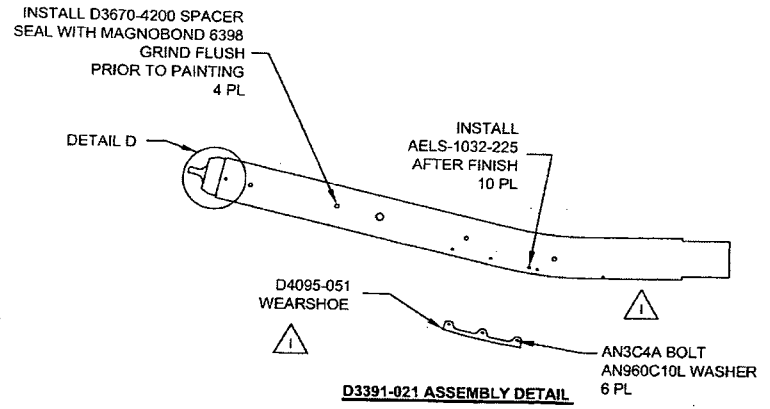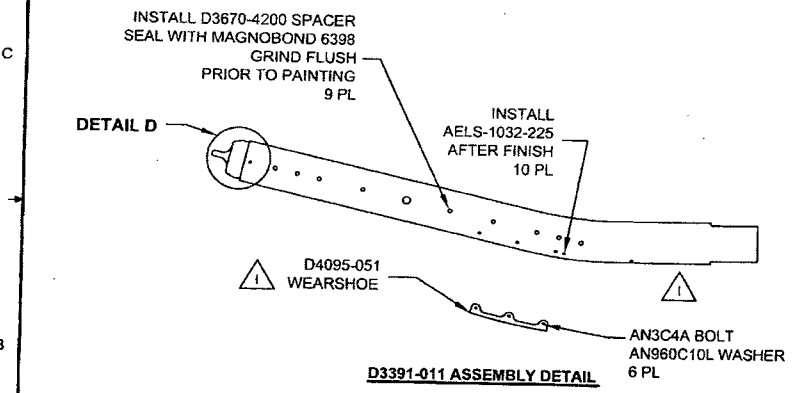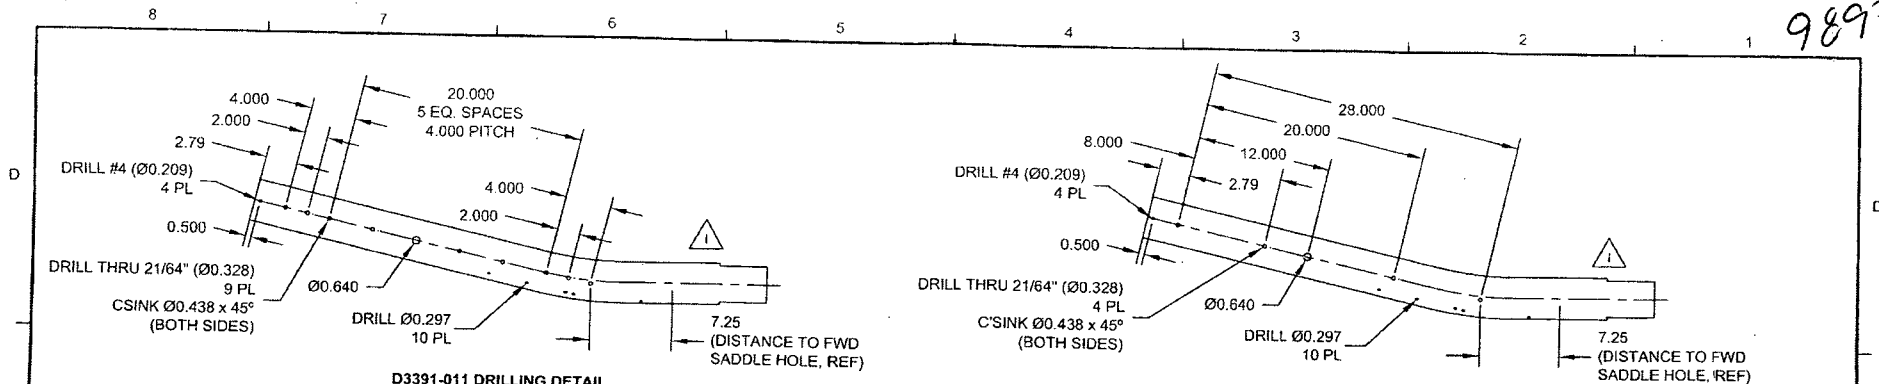

D3391-011/-021 FWD TUBE ASSEMBLY PARTS LIST


| QTY - 011 | QTY - 021 | PART NUMBER | DESCRIPTION |
|-----------|-----------|---------------|-------------------|
| X | X | D3391-011 | FWD TUBE ASSEMBLY |
| | | D3391-021 | FWD TUBE ASSEMBLY |
| 1 | 1 | D3401-041 | TOW CAP |
| 9 | 4 | D3670-4200 | SPACER |
| 4 | 4 | D3672-1 | WASHER |
| 1 | 1 | D4095-051 | WEARSHOE |
| 1 | 1 | D6013-047 | FWD TUBE |
| 10 | 10 | AN3C4A | BOLT |
| 10 | 10 | AN960C10L | WASHER |
| 10 | 10 | AELS-1032-225 | INSERT |

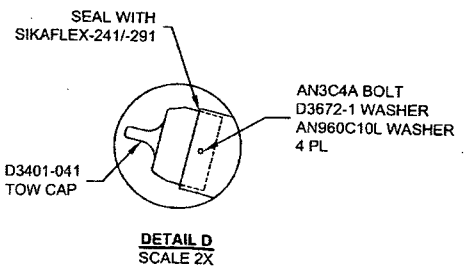


RELEASED
2011-11-04

| | | | |
|------------|----------|--|--------------|
| DESIGN | PH | DART AEROSPACE USA, INC | |
| DRAWN | XDF | KENT, WA | |
| CHECKED | | DRAWING NO. | REV. 1 |
| MFG. APPR. | | D3391 | SHEET 4 OF 8 |
| APPROVED | | TITLE | SCALE |
| DE APPR. | | 412 FLOAT SKIDTUBE | NTS |
| DATE | 11.10.13 | COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC. | |


98975

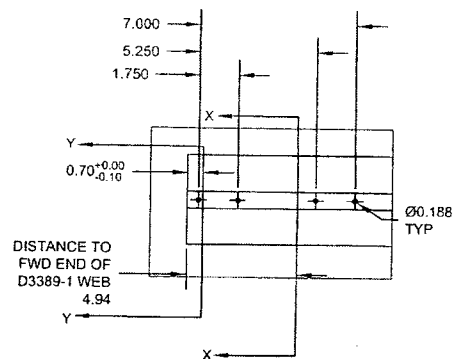

DETAIL J
SCALE 4X

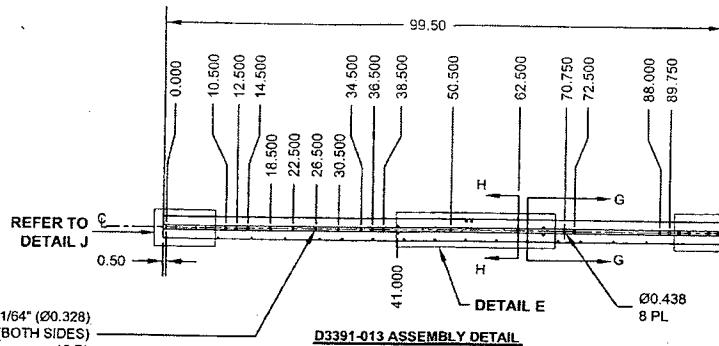


D3391-013 ASSEMBLY DETAIL

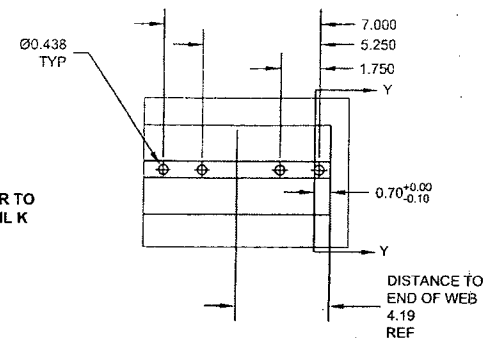


DETAIL K
SCALE 4X




SECTION G-G
SCALE 5X

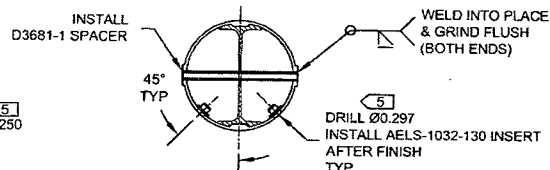

SECTION H-H
SCALE 5X

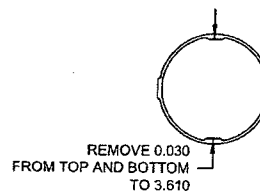

SECTION X-X
SCALE 5X

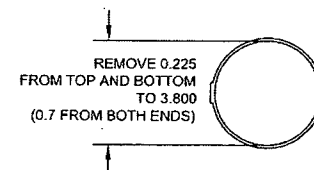


SECTION Y-Y
SCALE 5X

D3391-013 MID TUBE ASSEMBLY PARTS LIST

| QTY -013 | PART NUMBER | DESCRIPTION |
|-------------|---------------|-------------------|
| X | D3391-013 | MID TUBE ASSEMBLY |
| 1 | D2500-1-100 | EXTRUSION |
| 1 | D3389-1 | WEB |
| 4 | D3672-1 | WASHER |
| 4 | D3672-3 | WASHER |
| 12 | D3681-1 | SPACER |
| 24 | AELS-1032-130 | INSERT |
| 4 | ALS4-428-165 | INSERT |
| 4 | AN960C10L | WASHER |
| 4 | AN960C416L | WASHER |
| 4 | MS27039C1-09 | SCREW |
| 4 | MS27039C4-08 | SCREW |


D3391-013 MID TUBE ASSEMBLY

- MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
- INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/291 PER QSI 015
- WELDING: PER DART QSI 004

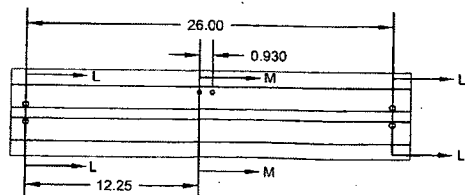


DETAIL E
SCALE NONE

DRILL Ø0.391
INSTALL ALS4-428-165 INSERT
MS27039C4-08 SCREW
D3672-3 WASHER
AN960C416L WASHER
AFTER FINISH
4 PL

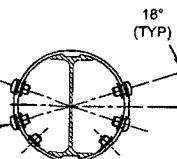


SECTION L-L
SCALE 5X

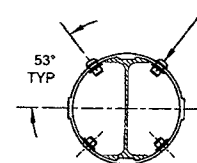

SECTION M-M
SCALE 5X

DRILL Ø0.297
INSTALL AELS-1032-130 INSERT
MS27039C1-09 SCREW
D3672-1 WASHER
AN960C10L WASHER
AFTER FINISH
4 PL

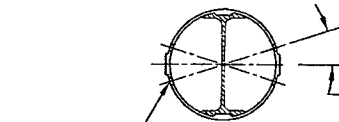


SECTION LL-LL
SCALE 5X


RELEASED
2011-11-04

| | | | |
|------------|----------|--|--------------|
| DESIGN | PH | DART AEROSPACE USA, INC | |
| DRAWN | XDF | KENT, WA | |
| CHECKED | | DRAWING NO. | REV. 1 |
| MFG. APPR. | | D3391 | SHEET 5 OF 8 |
| APPROVED | | TITLE | SCALE |
| DE APPR. | | 412 FLOAT SKIDTUBE | NTS |
| DATE | 11.10.13 | COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC. | |


98975

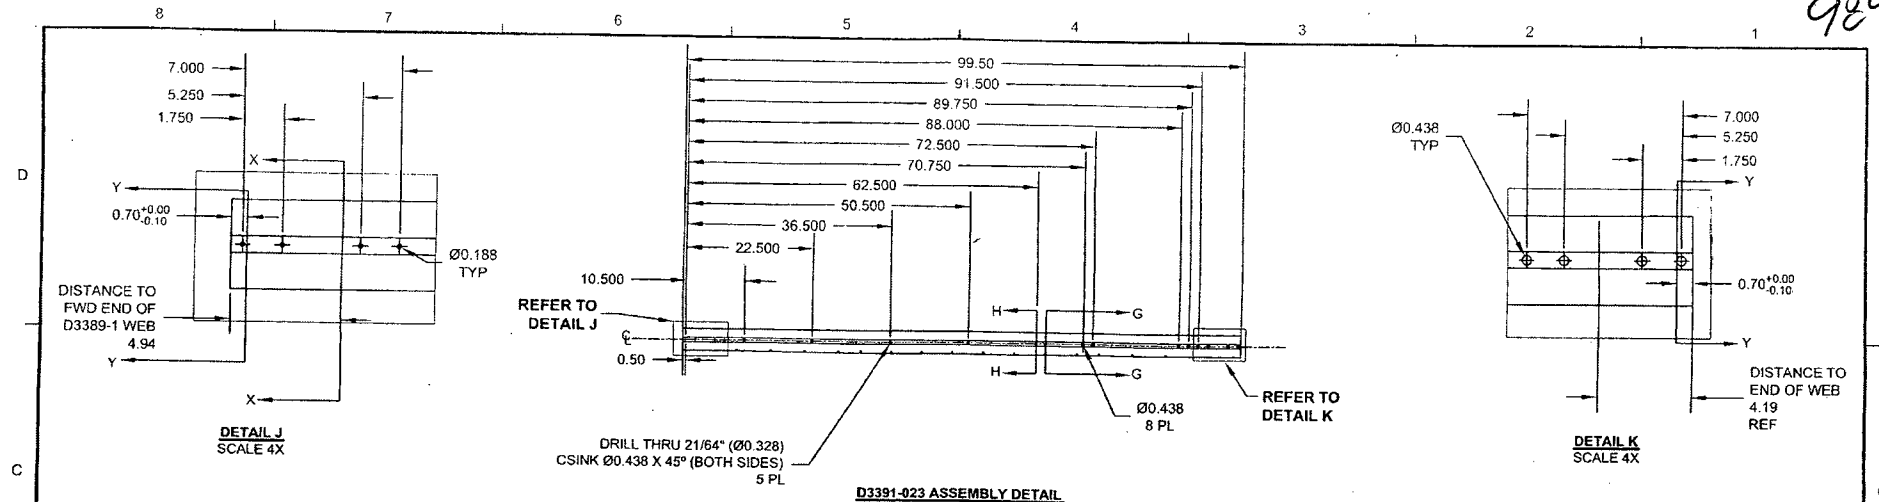


SECTION G-G
SCALE 5X

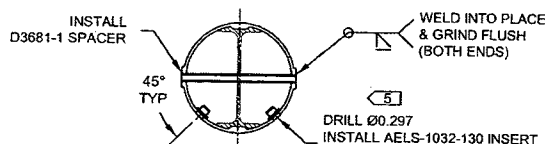

SECTION H-H
SCALE 5X

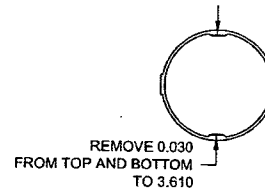

SECTION X-X
SCALE 5X

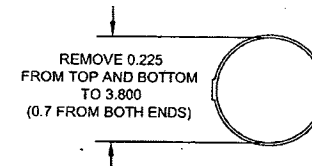

SECTION Y-Y
SCALE 5X

D3391-023 MID TUBE ASSEMBLY PARTS LIST

| QTY - 023 | PART NUMBER | DESCRIPTION |
|-----------|---------------|-------------------|
| X | D3391-023 | MID TUBE ASSEMBLY |
| 1 | D2500-1-100 | EXTRUSION |
| 1 | D3389-1 | WEB |
| 5 | D3681-1 | SPACER |
| 20 | AELS-1032-130 | INSERT |


D3391-023 MID TUBE ASSEMBLY

- 1) MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
- 2) INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/291 PER QSI 015
- 3) WELDING: PER DART QSI 004


RELEASED
2011-11-04

| | | | |
|------------|----------|---|--------------|
| DESIGN | PH | DART AEROSPACE USA, INC | |
| DRAWN | XDF | KENT, WA | |
| CHECKED | | DRAWING NO. | REV. 1 |
| MFG. APPR. | | D3391 | SHEET 6 OF 8 |
| APPROVED | | TITLE | SCALE |
| DE APPR. | | 412 FLOAT SKIDTUBE | NTS |
| DATE | 11.10.13 | <small>COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR IN ANY MANNER OR FOR ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small> | |

98975

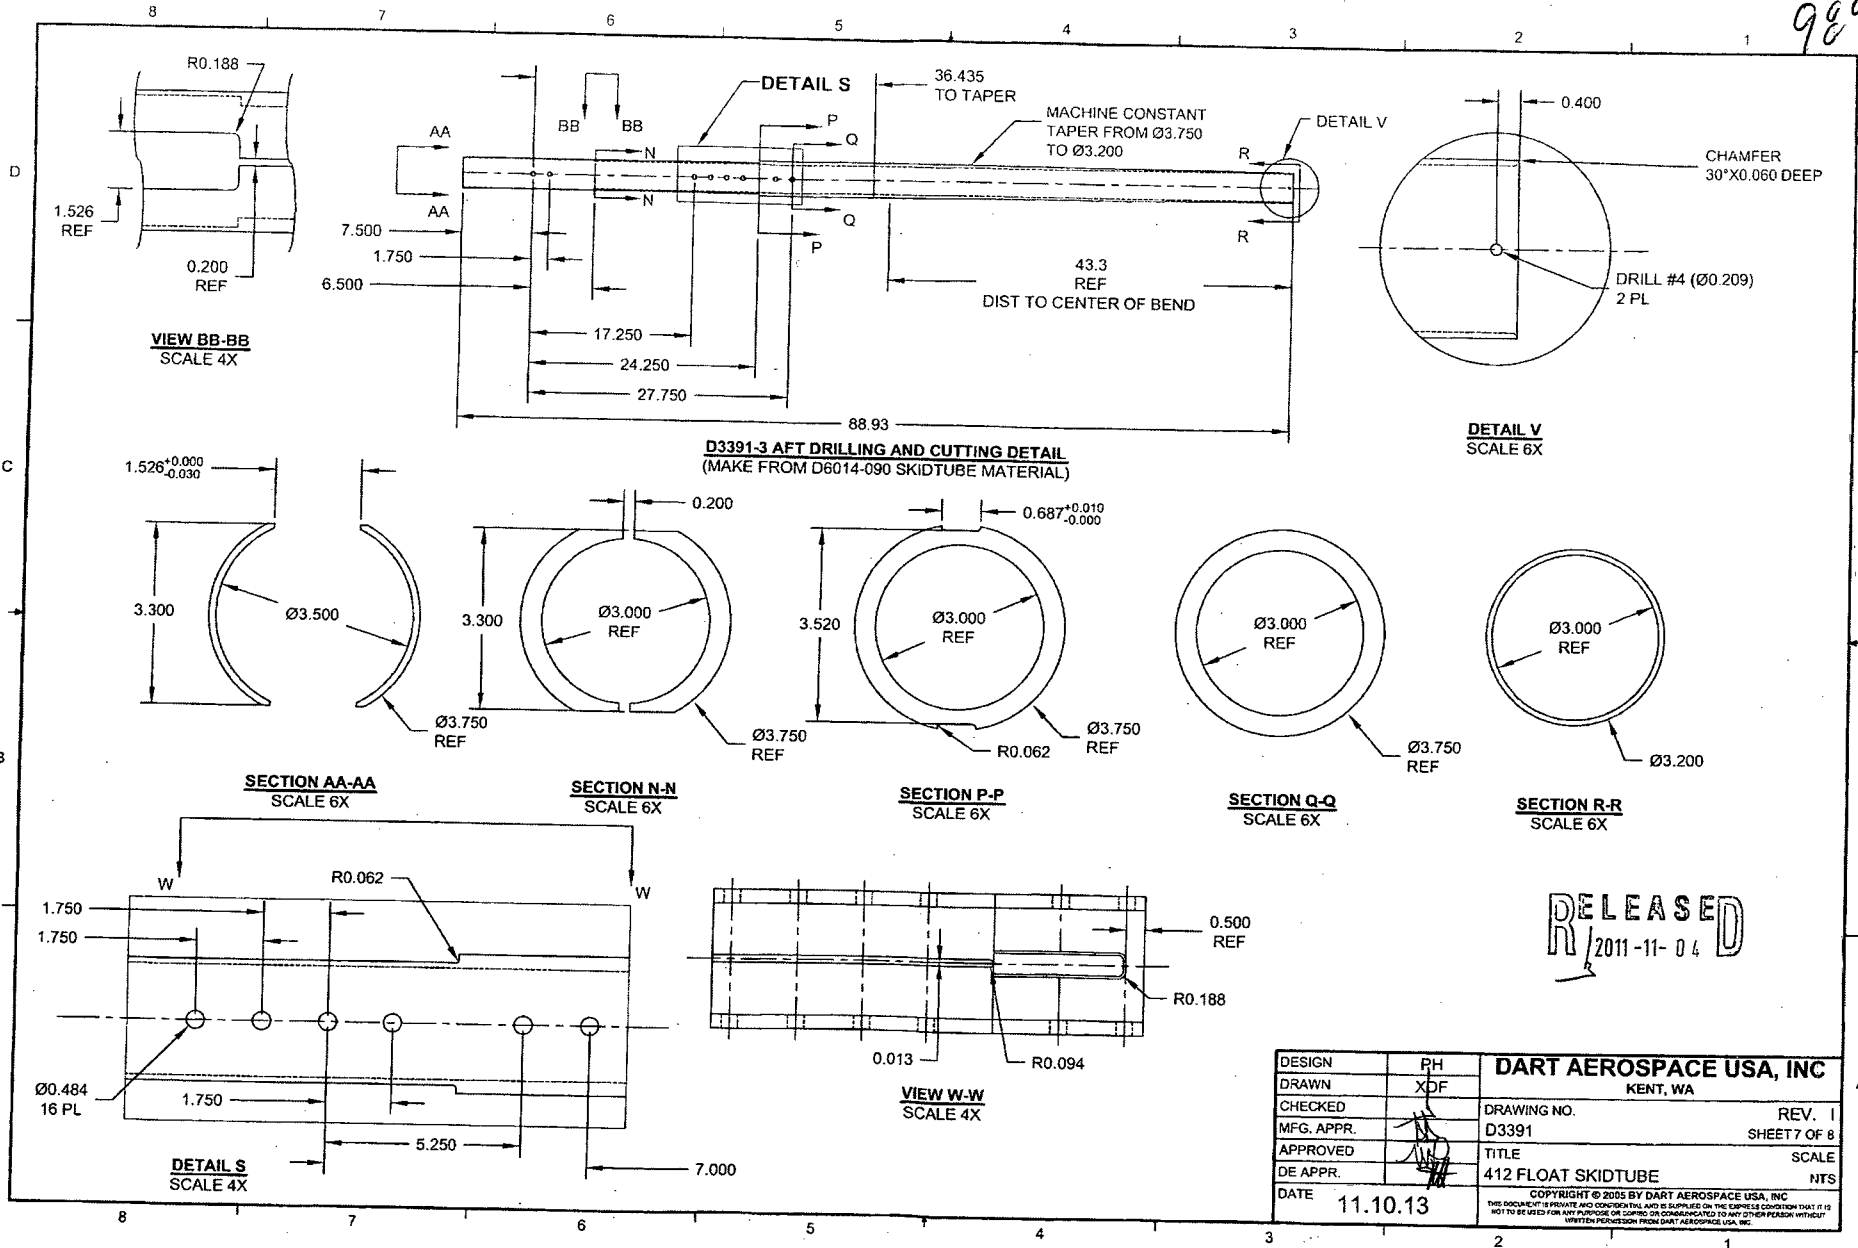


98975

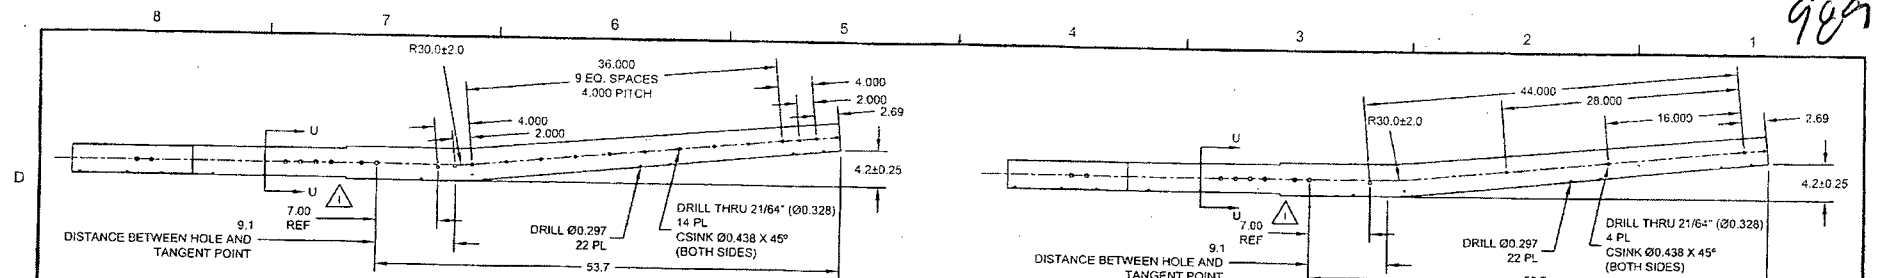


D3391-015 BENDING AND DRILLING DETAIL
(SEE CBORE DETAIL BELOW)

D3391-025 BENDING AND DRILLING DETAIL
(SEE CBORE DETAIL BELOW)

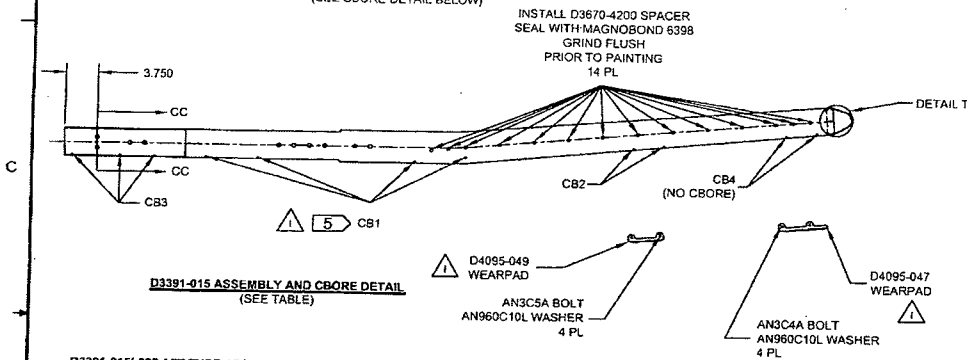


D3391-015 ASSEMBLY AND CBORE DETAIL
(SEE TABLE)

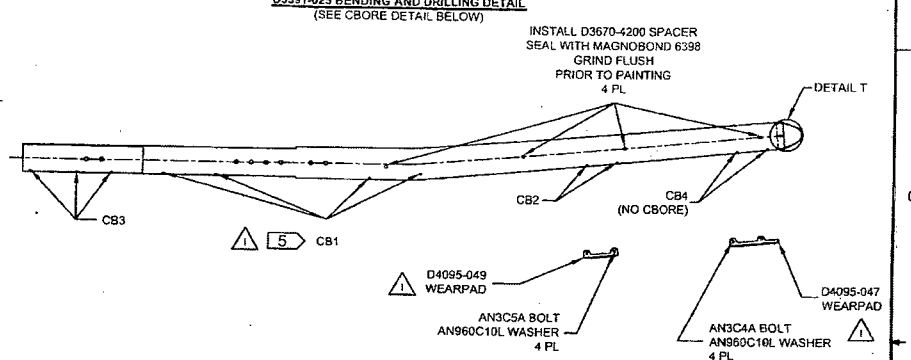


D3391-025 ASSEMBLY AND CBORE DETAIL
(SEE TABLE)

D3391-015/025 AFT TUBE ASSEMBLY PARTS LIST

| QTY - 015 | QTY - 025 | PART NUMBER | DESCRIPTION |
|-----------|-----------|---------------|-------------------|
| X | X | D3391-015 | AFT TUBE ASSEMBLY |
| | | D3391-025 | AFT TUBE ASSEMBLY |
| 1 | 1 | D2646 | AFT CAP |
| 14 | 4 | D3670-4200 | SPACER |
| 2 | 2 | D3672-1 | WASHER |
| 1 | 1 | D4095-049 | WEARPAD |
| 1 | 1 | D4095-047 | WEARPAD |
| 1 | 1 | D6014-090 | AFT TUBE |
| 14 | 14 | AELS-1032-130 | INSERT |
| 8 | 8 | AELS-1032-225 | INSERT |
| 4 | 4 | ALS4-428-165 | INSERT |
| 6 | 6 | AN3C4A | BOLT |
| 4 | 4 | AN3C5A | BOLT |
| 10 | 10 | AN960C10L | WASHER |

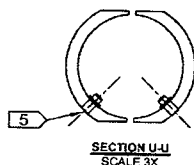


SECTION U-U
SCALE 3X

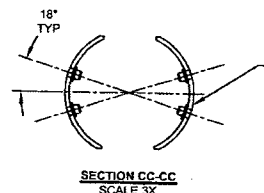

SECTION CC-CC
SCALE 3X

DRILL 0.391
CBORE 0.516 X 0.040 DEEP
INSTALL ALS4-428-165 INSERT
4 PL

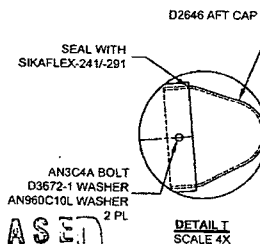

DETAIL T
SCALE 4X

CBORE HOLES MARKED CB1-CB4 AS FOLLOWS AND
INSTALL AELS-1032-XXXX AFTER FINISH AS NOTED

| HOLES MARKED | QTY D3391-015 | QTY D3391-025 | CBORE | P/N |
|--------------|---------------|---------------|---------------|---------------|
| CB1 | 8 | 8 | 0.430 X 0.170 | AELS-1032-225 |
| CB2 | 4 | 4 | 0.430 X 0.170 | AELS-1032-130 |
| CB3 | 6 | 6 | 0.430 X 0.040 | AELS-1032-130 |
| CB4 | 4 | 4 | NONE | AELS-1032-130 |

| | | | |
|------------|----------|--|--------------|
| DESIGN | PH | DART AEROSPACE USA, INC | |
| DRAWN | XDF | KENT, WA | |
| CHECKED | | DRAWING NO. | REV. 1 |
| MFG. APPR. | | D3391 | SHEET 8 OF 8 |
| APPROVED | | TITLE | SCALE |
| DE APPR. | | 412 FLOAT SKIDTUBE | NTS |
| DATE | 11.10.13 | COPYRIGHT © 2005 BY DART AEROSPACE USA, INC. | |

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

NO. 32

AWS D17.1.2001
QUALIFICATION TEST RECORD

Name: Barday Elliott
Job #: 94362
Part #: BD3391-023
Description: Mid tube
Welding Process: Tig[☒] Mig[]
Base material: Aluminium
Current: AC[☒] DC[]

TEST REQUIREMENTS AND RESULTS

| | | |
|-------------------------|---|---------|
| Visual: | pass[<input checked="" type="checkbox"/>] | fail[] |
| Incomplete Penetration: | pass[<input checked="" type="checkbox"/>] | fail[] |
| Incomplete Fusion: | pass[<input checked="" type="checkbox"/>] | fail[] |
| Cracks: | pass[<input checked="" type="checkbox"/>] | fail[] |
| Overlap (cold lap) | pass[<input checked="" type="checkbox"/>] | fail[] |
| Undercut: | pass[<input checked="" type="checkbox"/>] | fail[] |
| Pin holes: | pass[<input checked="" type="checkbox"/>] | fail[] |
| Porosity (surface): | pass[<input checked="" type="checkbox"/>] | fail[] |
| Coloration: | pass[<input checked="" type="checkbox"/>] | fail[] |
| Burn through: | pass[<input checked="" type="checkbox"/>] | fail[] |

Qualifier DAS 09 Date of Test Coupon 13-01-29
Welder Barday Elliott Date of Test Coupon 13-01-29

The above named individual is qualified in accordance with AWS D17.1.2001 to weld